

PRODUCT BULLETIN

Subject: LP2017 Design Change
Date: 01-07-10
Bulletin Number: 10-0107 LP2017 Design Change

Champion Laboratories, Inc / Luberfiner has initiated a design change on part number LP2017. This is a running change.


LP2017 is now being shipped with the new core adaptor and instructions. This new version will fit the 2009 and 2010 Ford Super Duty 6.4L engines as well as all previous application years. The new filter can be identified with the label on the box that says (FITS 2003-2010).

If a customer still has a LP2017 that does not have the new style core adaptor they can request it be shipped to them by their customer service representative at (800-851-3641). Reference part number 000537050 this will include the new core and instruction sheet. All LP2017 filters shipped from Champion since mid December will have the new style core adaptor.

**- IMPORTANT! - First Determine
Housing Style Before Servicing**




Service Instructions:

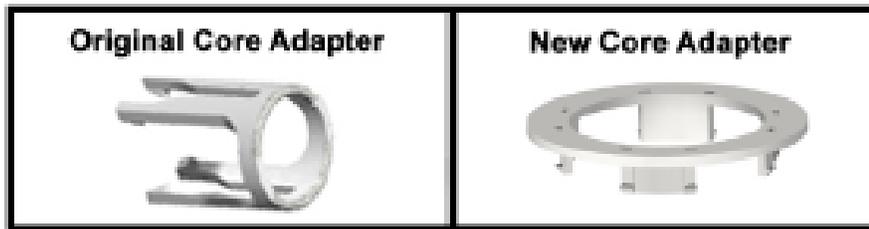


1. A new “Corer Adapter”  is required to service style A housings. (See illustrations above.) To service style A housings proceed to step 2. To service style B housings discard the core adapter and proceed to step 5.

2. If either core adapter has already been installed, proceed to step 6, filter installation.

3. Align the holes on top of the core assembly between the legs of the new core adapter. (See Fig 1.)

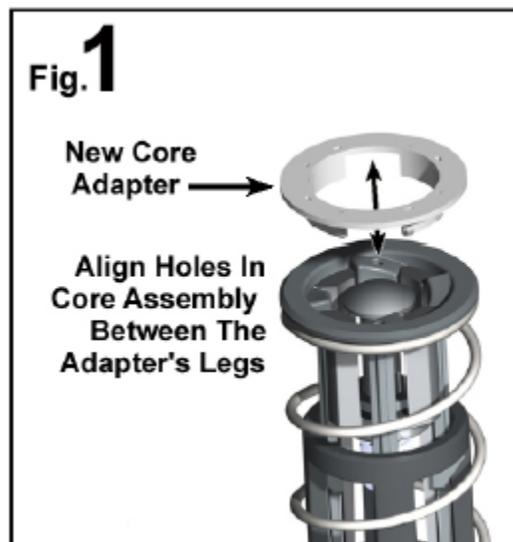

4. With core adapter in position, (see fig 2), press core adapter firmly to snap in place. (see fig. 3)

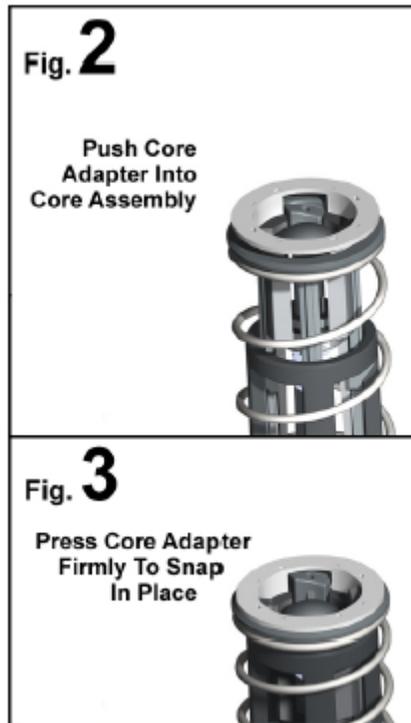

5. Remove the old O-ring from the cap, lubricate new O-ring with clean oil and install on cap.

6. Install filter element and threaded cap.

7. Tighten cap to 18.5 ft-lbs torque.

Need help? See www.coreadapter.com

for more details and installation video.